

Emergent Software Update Notice


Affected Ranges

Affect models: MT8050iE1, MT6070iE2, MT8071/8073iE1, MT8100iE2, and
MT8101/8102/8103iE1

Affect OS version: 20160325 (only this version)


Description

MT8000iE Series with OS 20160325 will mal-function if you use the following features in your EBPro project. HMI may show black screen as shown below.




The features include:


- a. When using **Option List Object**, [Source of item data] uses [Dates of history data].

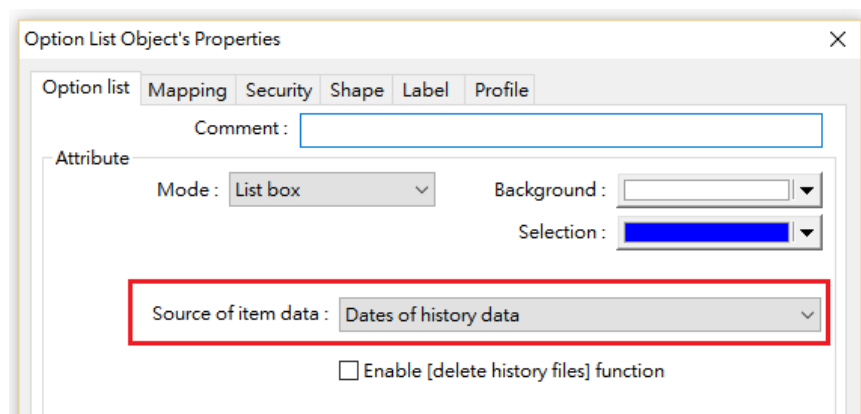


b. File Browser Object

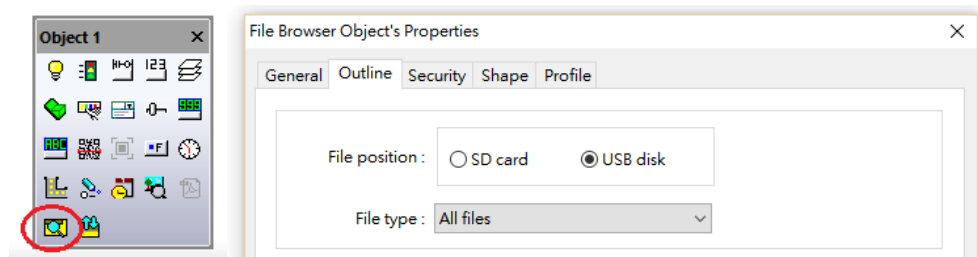

- c. When using **PLC Control Object**, [Customized filename handling] check box is selected in Screen Hardcopy mode.

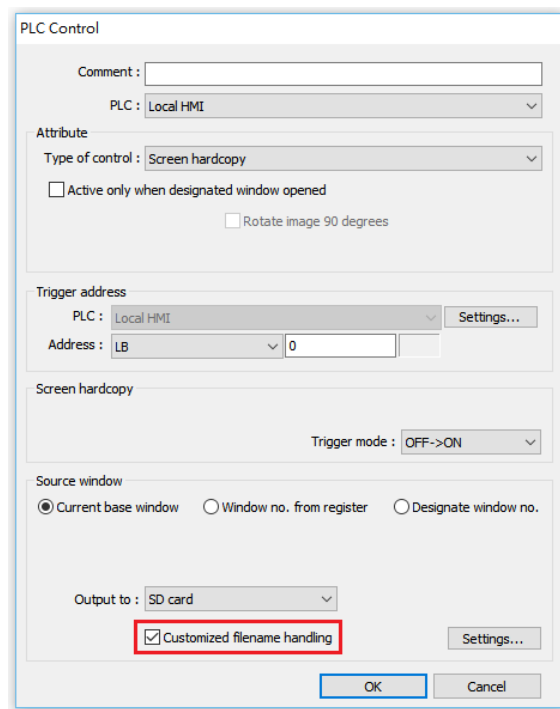

d. Import/Export Object

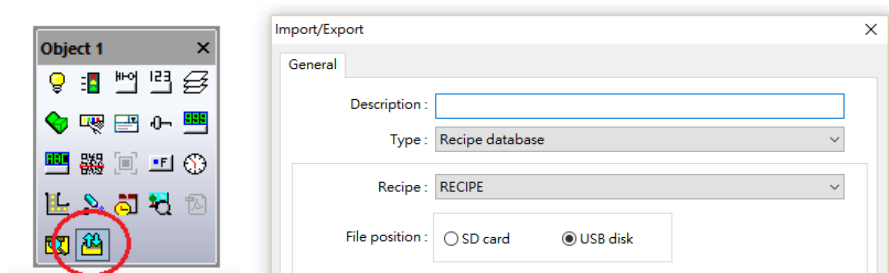

e. String Table


String Table

Section: [ID:000] String Table 1 [New Section] [Delete Section]

Description: String Table 1

String ID	Language 1	Language 2	Language 3	Language 4	Language 5
0	Label 1	Label 1			

Please check if your HMI OS version is 2016035.

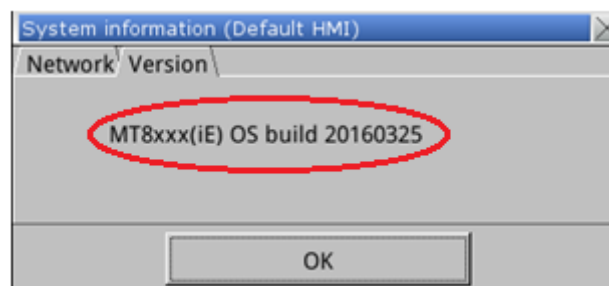

How to Fix

If you are using this version (20160325), you can use one of the following solutions to fix the above problems.

Solution 1

Upgrade your HMI OS to 20160417.

<https://gofile.me/2kurG/JkLgtjNBL>

Solution 2

Upgrade your EasyBuilder Pro version to 5.03.02.068 or later version.

EasyBuilder Pro V5.03.02.069

<https://gofile.me/2kurG/EwI7QI3tP>

EasyBuilder Pro V5.04.01.035

<https://gofile.me/2kurG/yVzrz9C4M>